HIOKI

# POWER METER PW3336, PW3337

High-precision, 3-channel power meter with built-in harmonic measurement

## Accurately measure devices up to 1000 V/65 A AC/DC with direct input


The PW3336 (2-channel) and PW3337 (3-channel) can measure DC and a variety of power connections ranging from single-phase 2-wire to 3-phase 4-wire*.

- For development and production of motors, inverters, power conditioners, power supplies, and other devices
- Assess and verify the energy-saving performance of industrial equipment such as heavy machinery, air-conditioners as well as household appliances

| | |
|---|---|
| • Voltage, current, and power basic accuracy | : ±0.1% ** |
| • Measurement frequency bands | : DC, 0.1 Hz to 100 kHz |
| • High-current measurement | : Up to 65 A, direct input |
| • Low-loss current input | : Input resistance of 1mΩ or less |
| • Harmonic measurement up to the 50th order | : IEC 61000-4-7 compliant |
| • High-accuracy measurement, even with a low power factor | : Ideal for no-load testing of transformers and motors |
| • Measure up to 5000 A AC | : Built-in external sensor input terminals |

CE

* 3-phase 4-wire measurement: PW3337 series only
** For complete details, please refer to the specifications.

# High-accuracy
# High-current
# Harmonic measurement

## Support for development and production of motors, transformers, air-conditioners, and other industrial equipment


The PW3336 series (2-channel) and PW3337 series (3-channel) are easy-to-use, high-accuracy power meters that deliver current measurement of up to 65 A with direct input as well as built-in harmonic analysis functionality, all with accuracy that exceeds that of previous HIOKI power meters.

World class performance

# *Measure up to 65 A with direct input*

## 1 Measurement accuracy that remains unchanged for high-current measurement

Accuracy is guaranteed for currents of up to 65 A with direct input. The power meters can also measure high currents in excess of 65 A with optional current sensors. Direct-input power meters typically exhibit degraded accuracy when inputting high currents due to shunt resistor self-heating. However, the PW3336 and PW3337 reduce input resistance with a DCCT design that virtually eliminates this type of accuracy degradation.

2mA **65A** 5000A

**Direct input** Sensor input

## 2 A 3-channel power meter

**Enabling you to select the optimal range for each connection**

The advanced engineering of the PW3336 and PW3337 enables you to measure an inverter's primary-side DC power supply and its secondary-side 3-phase output at the same time. The power meters make a tremendous contribution in applications that need to measure the input/output efficiency of inverters, uninterruptible power supplies, and other power supply equipment.

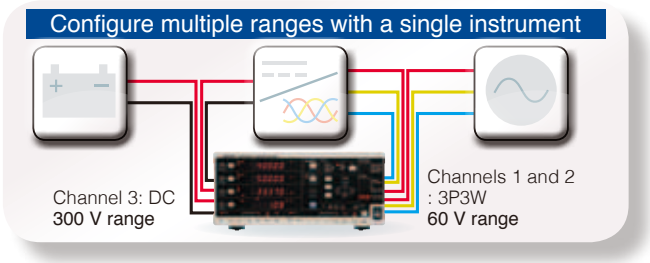


## 3 Best-in-class accuracy of ±0.1% *

**Highest basic accuracy and DC accuracy of any instrument in its class**

Thanks to Hioki's accumulated technology and track record, the PW3336/PW3337 delivers the highest basic accuracy and DC accuracy of any instrument in its class. Reliable measurement accuracy ensures robust performance in customers' measurement applications.

**±0.1%***

* For complete details, please refer to the specifications.

# Simultaneously measure power consumption and all harmonic parameters, from single-phase 2-wire to 3-phase 4-wire measurement lines

## 2ch

PW3336 series (2-channel models)
Measurement lines: 1P2W/1P3W/3P3W

## 3ch

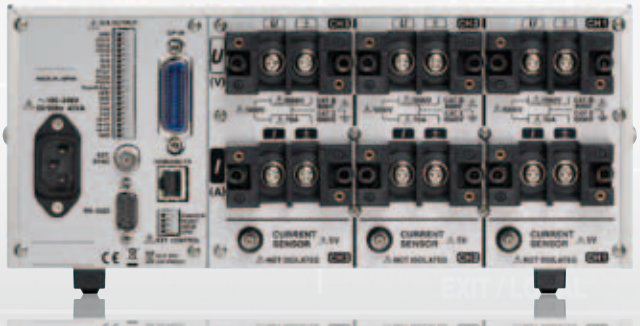

PW3337 series (3-channel models)
Measurement lines: 1P2W/1P3W/3P3W/3P4W

## World class performance

### 4 Simultaneous processing of power data and all harmonic data

All data, including RMS values, mean values, DC components, AC components, fundamental wave components, harmonic measurement, and integration measurement, is processed in parallel internally. There is no need to switch modes depending on whether you wish to acquire power data or harmonic data-- simply switch the display to obtain measured values with true simultaneity. Additionally, PC communications software can be used to capture measurement data, including from multiple synchronized instruments.

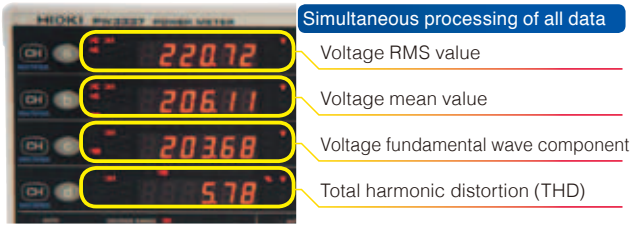


### 5 High-accuracy measurement, even with low-power-factor input

Because power factor has little impact at just ±0.1% f.s., the PW3336/PW3337 can measure active power of low-power-factor input at a high level of accuracy, for example during no-load-loss testing, a technique that is used to evaluate energy-saving performance of transformers.
Even though the high current waveform crest factor that typically accompanies no-load operation causes the power factor to deteriorate, measurements taken with the PW3336/PW3337 series remain accurate under these conditions.

### 6 Wide frequency band of DC and 0.1 Hz to 100 kHz

Thanks to a wide-band capability extending from DC and 0.1 Hz to 100 kHz, the PW3336/PW3337 can cover not only inverters' fundamental frequency band, but also the carrier frequency band.

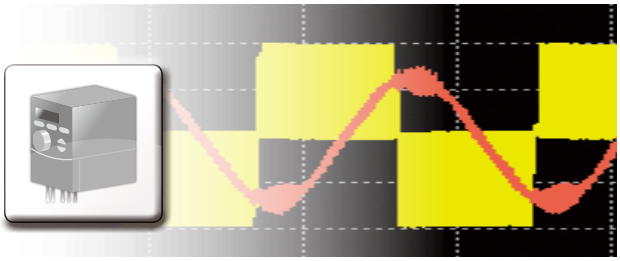

### 7 Integrating fluctuating power values

The power consumption of equipment subject to a fluctuating load, for example refrigerators, heaters, and pumps, varies considerably between rated operation and no-load operation. Thanks to its broad dynamic range, the PW3336/PW3337 can perform integrated power measurement with guaranteed accuracy using a single range, even if the power fluctuates dramatically during integration. Measurements can accommodate waveform peaks of up to 600% of the range rating.

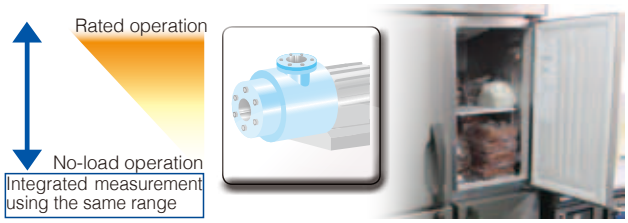

Advanced functions

## 1 Extensive built-in features including harmonic measurement, current sensor input, synchronized control, and a wide selection of interfaces

The PW3336/PW3337 ships standard with all the functionality you need for measurement. Choose from a total of eight models depending on whether your application requires support for GP-IB communications and D/A output.

Standard functionality by model ●: Built-in function —: Function not available

| Model | No. of channels | Harmonic measurement | Current sensor input | Synchronized control | LAN | RS-232C | GP-IB | D/A output |
|---|---|---|---|---|---|---|---|---|
| PW3336 | 2 | ● | ● | ● | ● | ● | — | — |
| PW3336-01 | | ● | ● | ● | ● | ● | ● | — |
| PW3336-02 | | ● | ● | ● | ● | ● | — | ● |
| PW3336-03 | | ● | ● | ● | ● | ● | ● | ● |
| PW3337 | 3 | ● | ● | ● | ● | ● | — | — |
| PW3337-01 | | ● | ● | ● | ● | ● | ● | — |
| PW3337-02 | | ● | ● | ● | ● | ● | — | ● |
| PW3337-03 | | ● | ● | ● | ● | ● | ● | ● |

## 2 IEC61000-4-7 compliant harmonic measurement

The PW3336/PW3337 supports measurement that complies with IEC 61000-4-7:2002, the international standard governing harmonic measurement.
The power meters can measure voltage, current, and power harmonics up to the 50th order depending on the fundamental frequency, including total harmonic distortion (THD), fundamental wave component, harmonic level, phase difference, content percentage, and other parameters for each order. Since you can cap the number of orders for which harmonic analysis is performed to any order from the 2nd to the 50th, you can make standard-compliant calculations, even if the standard defines an upper limit order for THD calculations.

### About IEC 61000-4-7

IEC 61000-4-7 is an international standard governing the measurement of harmonic current and harmonic voltage in power supply systems as well as harmonic current emitted from devices. It defines the performance of standard instruments used to make such measurements.

## 3 Large selection of interfaces

The PW3336/PW3337's interfaces can be used to control the instrument and to capture its data - simply download the free PC application from the HIOKI website. Functionality supported via LAN connections includes power meter configuration, measured value monitoring, waveform monitoring, display of time-series recordings, and capturing data at intervals.

GP-IB (-01, -03)
RS-232C
LAN

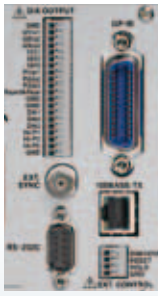

PW3336-03
PW3337-03

## 4 16-channel D/A output (-02, -03)

D/A output-equipped instruments can generate voltage output for measured values and integrated power with their 16-bit D/A converter. By connecting an external data logger, HIOKI Memory HiCorder, recorder, or other device, you can simultaneously record data along with temperature and other non-power signals. The PW3336/PW3337 also offers the first active power level output on a cycle-by-cycle basis of any instrument in its class.

### Three types of D/A output (switchable)

**Instantaneous waveform output**
Output voltage, current, or power instantaneous waveforms. (Sampling speed: Approx. 87.5 kHz)

**Level output**
Output voltage, current, power, and other selected parameters with an update cycle of approximately 200 ms.

**High-speed active power level output**
Generate level output for the active power for each cycle of the measurement waveform.

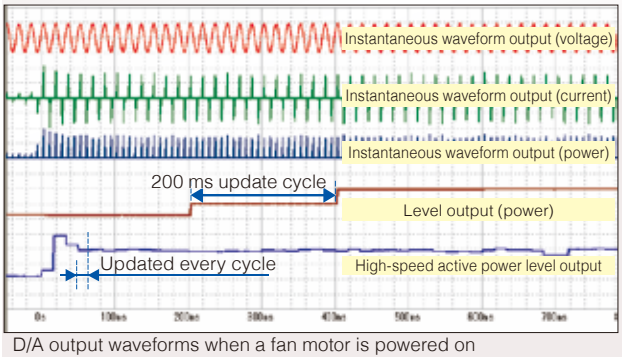


D/A output waveforms when a fan motor is powered on

## 5 Synchronized control using up to 8 instruments

Eight units of PW3336/PW3337 can be connected and their measurements fully synchronized. That means you can have up to 24 channels of simultaneous calculations, display updates, data updates, integration control, display hold timing, and zero-adjustment. In addition, the master-slave configuration allows you to key lock all slave devices with the master unit, mirroring the master unit's operations and modes on all of the other power meters. The free PC application can be used to calculate efficiency values across multiple units.

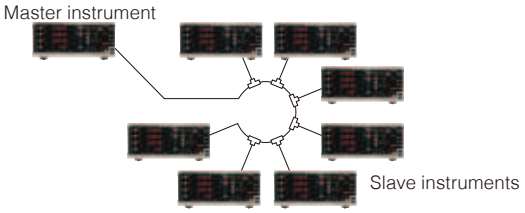


## 6 Current sensor connectivity

The PW3336/PW3337 can also measure devices that exceed 65 A with the use of an optional current sensor. Measurements with guaranteed accuracy can be performed for currents of up to 5000 A AC. Choose from a range of high-accuracy, clamp or pass-through AC/DC current sensors and models specifically designed for 50/60 Hz measurement.

## Applications

### 1 Research, development, and testing of equipment with 3-phase power supplies such as transformers, motors, air-conditioners, and heavy machinery

#### Key advantages

- ✔ Measure 3-phase 3-wire and 3-phase 4-wire* lines with a basic measurement accuracy of ±0.1%**
- ✔ Perform high-current measurement of 65 A with direct input without accuracy degradation caused by shunt resistor self-heating.
- ✔ Built-in IEC 61000-4-7 compliant harmonic measurement functionality as well as current sensor input terminals and a LAN interface.
- ✔ Accuracy is guaranteed for active power measurement from 0 W, as well as for measurement of integrated power for loads with large fluctuations.
- ✔ Measure active power at a high level of accuracy even with low power factors, for example during no-load operation testing of transformers.

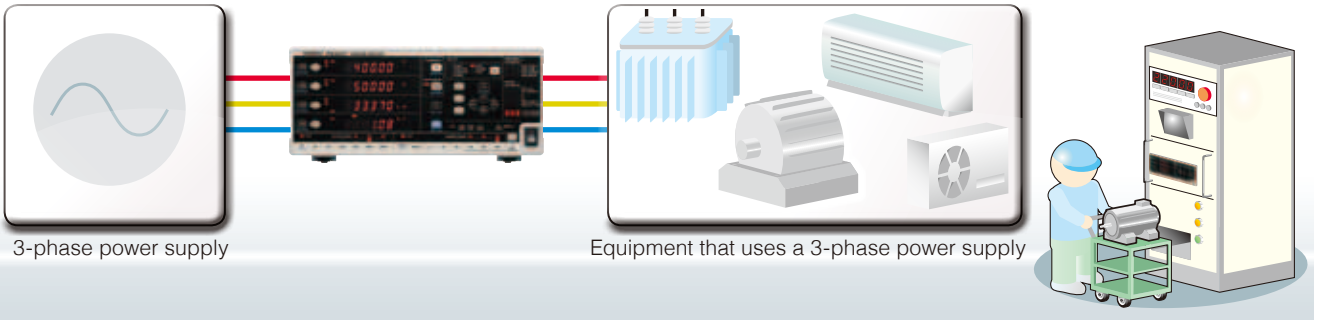


*3-phase 4-wire measurement: PW3337 series only ** For complete details, please refer to the specifications.

### 2 Measuring the efficiency of power conditioners used in solar power installations

#### Key advantages

- ✔ Measure primary-side DC and secondary-side 3-phase output with a single PW3337, using the optimal range for each.
- ✔ Calculate efficiency: Perform output/input calculations and easily identify the resulting efficiency on the power meter's screen.
- ✔ Ripple rate calculation: Display the ratio of the AC component that is superposed on a DC line.
- ✔ Built-in current sensor input terminals: Measure currents exceeding 65 A with an optional current sensor.
- ✔ Harmonic measurement: Test for harmonic components such as voltage THD, which can be a concern with grid-linked systems.

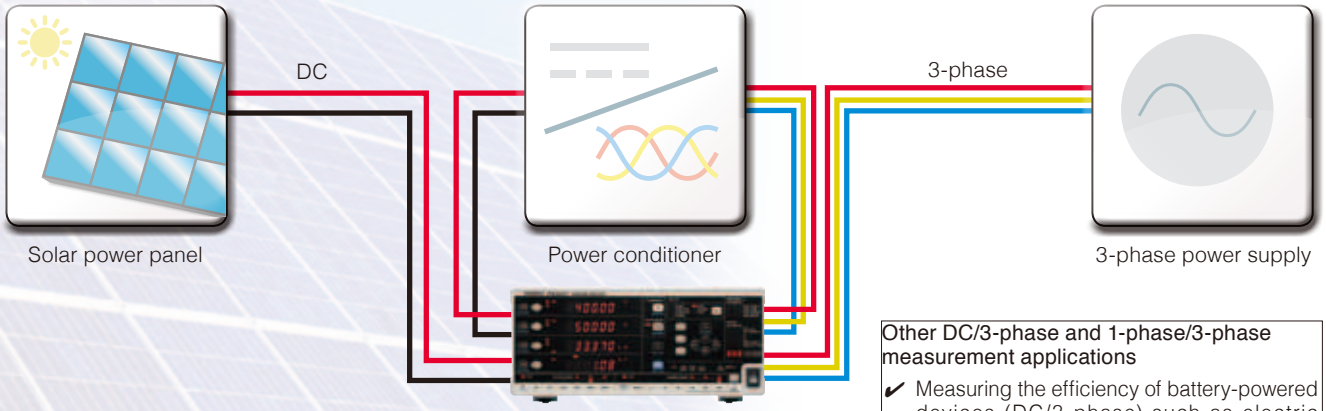


**Other DC/3-phase and 1-phase/3-phase measurement applications**

- ✔ Measuring the efficiency of battery-powered devices (DC/3-phase) such as electric vehicles
- ✔ Measuring the efficiency of rapid chargers for electric vehicles (3-phase/DC)

### 3 Measuring power supply devices such as 3-phase/3-phase inverters

#### Key advantages

- ✔ Connect multiple instruments to synchronize their operation, including display updates, data updates, and start of integration.
- ✔ Measure all data with simultaneous parallel processing, including RMS values, mean values, fundamental wave components, THD, and harmonic components.
- ✔ Wide frequency band from DC and 0.1 Hz to 100 kHz: Enjoy coverage for the inverter secondary-side frequency band.
- ✔ Built-in current sensor input terminals: Measure currents exceeding 65 A with an optional current sensor.

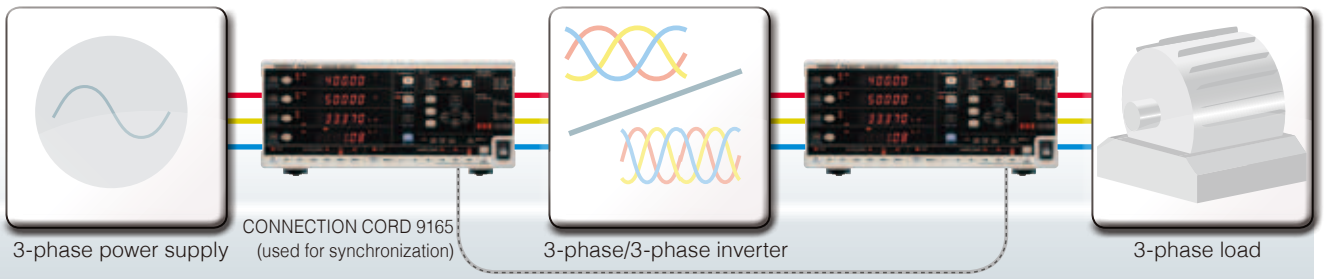

Applications

## 4 Measuring the primary-side, internal circuitry, and secondary-side power consumption in uninterruptible power supplies (UPS)

### Key advantages

- ✔ Set individual ranges and measurement types for each channel. Measure power consumption at each stage of the UPS.
- ✔ Hold waveform peak values and measured value maximum and minimum values.
- ✔ Measure all data with simultaneous parallel processing, including RMS values, mean values, fundamental wave components, THD, and harmonic components.

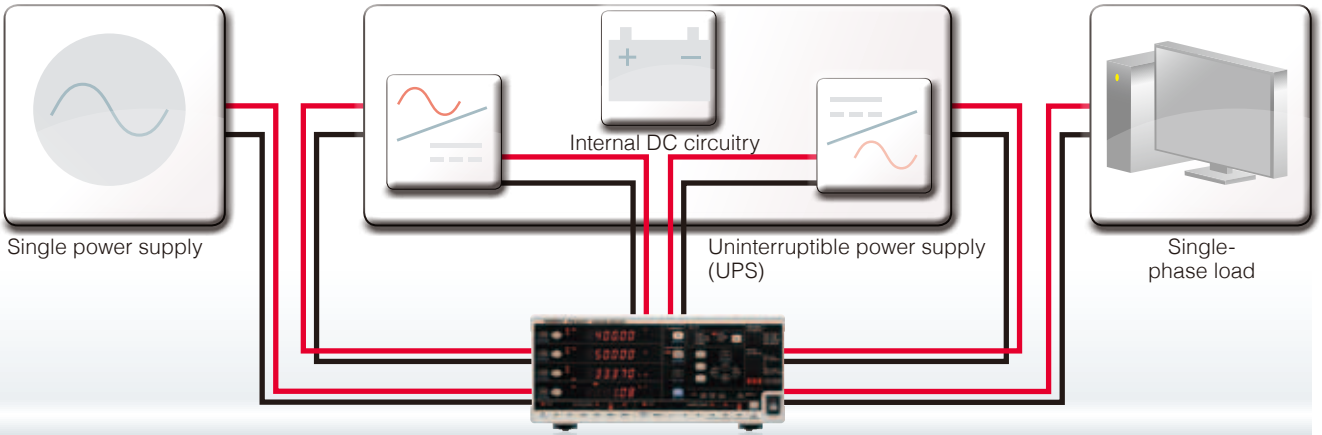


## 5 Simultaneous measurement of multiple loads

### Key advantages

- ✔ Set individual ranges and measurement types for each channel. Measure power consumption at each stage of an uninterruptible power supply.
- ✔ Perform integrated measurement of widely fluctuating power signals without changing the range - useful during long-term integrated power evaluation tests.
- ✔ Use the synchronized control function to sync measurement timing and start/stop integration across a maximum of 8 power meters.

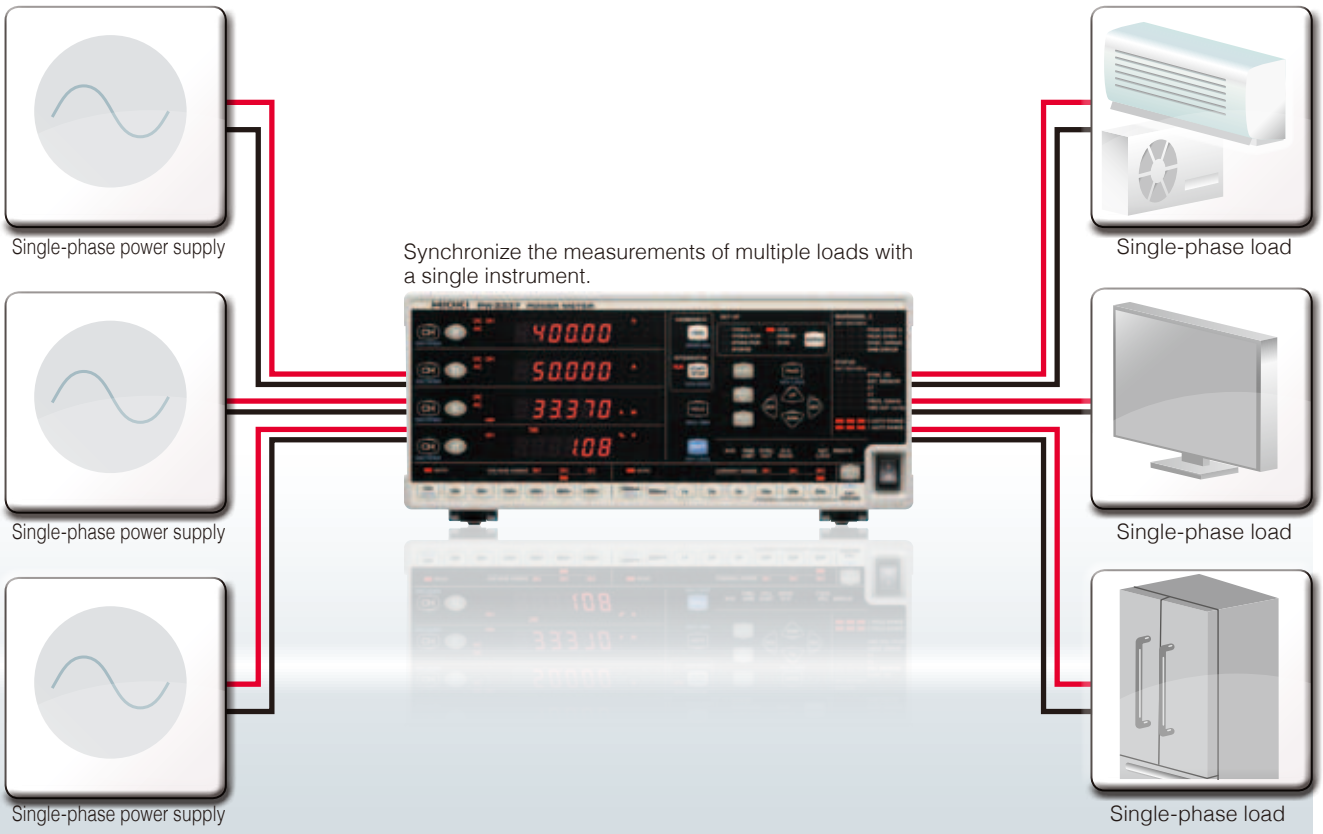

## Software

# PW3336/PW3337 Communicator

The PW3336/PW3337 Communicator connects with the power meters via the LAN, RS-232C, or GP-IB (-01, -03) interface, and is available for free download from the HIOKI website. Functionality includes configuring instruments, capturing interval data, performing numerical calculations based on measurement data, calculating efficiency values across multiple units, displaying 10 or more measurement parameters, and displaying waveforms.

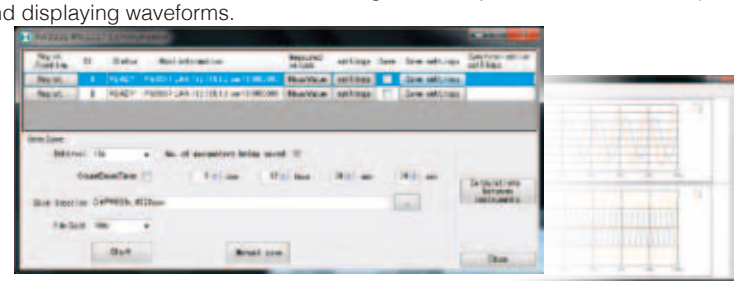

# LabVIEW Driver

Use LabVIEW* to collect data and integrate the power meter into existing systems.
*LabVIEW is a trademark of National Instruments Corporation.

## Dimensional drawings

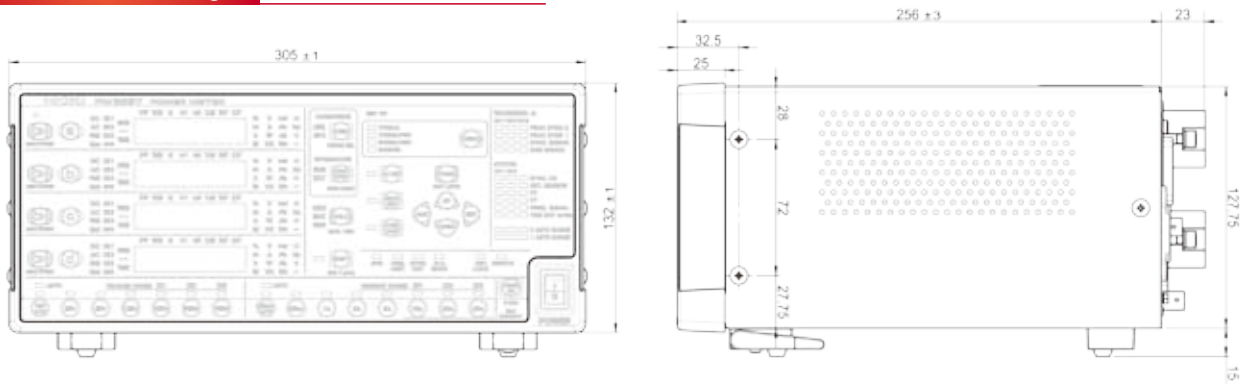


(Unit: mm)

## Specifications

### Input Specifications

| | |
|---|---|
| Measurement line type | PW3336 series<br>Single-phase 2-wire (1P2W),<br>Single-phase 3-wire (1P3W),<br>Three-phase 3-wire (3P3W, 3P3W2M) |

| Wiring | CH1 | CH2 |
|---|---|---|
| 1P2W×2 | 1P2W | 1P2W |
| 1P3W | 1P3W | |
| 3P3W | 3P3W | |
| 3P3W2M | 3P3W2M | |

PW3337 series
Single-phase 2-wire (1P2W),
Single-phase 3-wire (1P3W),
Three-phase 3-wire (3P3W, 3P3W2M, 3V3A, 3P3W3M),
Three-phase 4-wire (3P4W)

| Wiring | CH1 | CH2 | CH3 |
|---|---|---|---|
| 1P2W×3 | 1P2W | 1P2W | 1P2W |
| 1P3W&1P2W | 1P3W | | 1P2W |
| 3P3W&1P2W | 3P3W | | 1P2W |
| 3P3W2M | 3P3W2M | | |
| 3V3A | 3V3A | | |
| 3P3W3M | 3P3W3M | | |
| 3P4W | 3P4W | | |

| | |
|---|---|
| Input methods | Voltage Isolated input, resistance voltage division method<br>Current Isolated input, DCCT method Isolated input from current sensors |
| Voltage measurement ranges | AUTO/ 15.000 V/ 30.000 V/ 60.000 V/ 150.00 V/ 300.00 V/ 600.00 V/ 1000.0 V (set for each wiring mode) |
| Current measurement ranges | AUTO/ 200.00 mA/ 500.00 mA/ 1.0000 A/ 2.0000 A/ 5.0000 A / 10.000 A/ 20.000 A/ 50.000 A (set for each wiring mode)<br>For more information about external current sensor input, see the external current sensor input specifications |
| Power ranges | Depends on the combination of voltage and current ranges;<br>PW3336: from 3.0000W to 100.00kW (also applies to VA, var)<br>PW3337: from 3.0000W to 150.00kW (also applies to VA, var) |
| Input resistance (50/60 Hz) | Voltage input terminal : 2 MΩ±0.04 MΩ<br>Current direct input terminal : 1 mΩ or less |

### Basic Measurement Specifications

| | |
|---|---|
| Measurement method | Simultaneous voltage and current digital sampling, zero-cross simultaneous calculation |
| Sampling frequency | Approx. 700 kHz |
| A/D converter resolution | 16-bit |
| Frequency bands | DC, 0.1 Hz to 100 kHz |
| Synchronization sources | U1, U2, U3, I1, I2, I3, DC (fixed at 200 ms)<br>Can be set separately for each wiring mode. |
| Measurement items | · Voltage · Current · Active power · Apparent power<br>· Reactive power · Power factor · Phase angle · Frequency<br>· Efficiency · Current integration · Active power integration · Integrated time<br>· Voltage waveform peak value · Current waveform peak value<br>· Voltage crest factor · Current crest factor<br>· Time average current · Time average active power<br>· Voltage ripple factor · Current ripple factor<br>Harmonic parameters:<br>· Harmonic voltage RMS value · Harmonic current RMS value<br>· Harmonic active power · Total harmonic voltage distortion<br>· Total harmonic current distortion · Voltage fundamental waveform<br>· Current fundamental waveform · Active power fundamental waveform<br>· Apparent power fundamental waveform · Reactive power fundamental waveform<br>· Power factor fundamental waveform (displacement power factor)<br>· Voltage current phase difference fundamental waveform<br>· Interchannel voltage fundamental wave phase difference<br>· Interchannel current fundamental wave phase difference<br>· Harmonic voltage content % · Harmonic current content %<br>· Harmonic active power content %<br>The following parameters can be downloaded as data during PC communication but not displayed:<br>· Harmonic voltage phase angle · Harmonic current phase angle<br>· Harmonic voltage current phase difference |
| Rectifiers | AC+DC : AC+DC measurement<br>Display of true RMS values for both voltage and current<br>AC+DC Umn : AC+DC measurement<br>Display of average value rectified RMS converted values for voltage and true RMS values for current<br>DC : DC measurement<br>Display of simple averages for both voltage and current<br>Display of values calculated by (voltage DC value)× (current DC value) for active power<br>AC : AC measurement<br>Display of values calculated by for both voltage and current<br>Display of values calculated by $\sqrt{(AC+DC\ value)^2 - (DC\ value)^2}$ for active power<br>FND<br>Extraction and display of the fundamental wave component from harmonic measurement |
| Zero-Crossing Filter | 500 Hz/200 kHz<br>500 Hz: 0.1 Hz to 500 Hz, 200 kHz: 0.1 Hz to 200 kHz |
| Maximum effective peak voltage | ±600% of each voltage range<br>However, for 300 V, 600 V, and 1000 V ranges, ±1500 Vpeak |
| Maximum effective peak current | ±600% of each current range<br>However, for 20 A range and 50 A range, ±100 Apeak |

Measurement accuracy

Voltage

| Frequency (f) | Input < 50% f.s. | 50%f.s. ≤ Input < 100%f.s. | 100%f.s. ≤ Input |
|---|---|---|---|
| DC | ±0.1%rdg. ±0.1%f.s. | ±0.1%rdg. ±0.1%f.s. | ±0.2%rdg. |
| 0.1Hz ≤ f < 16Hz | ±0.1%rdg. ±0.2%f.s. | ±0.3%rdg. | ±0.3%rdg. |
| 16Hz ≤ f < 45Hz | ±0.1%rdg. ±0.1%f.s. | ±0.2%rdg. | ±0.2%rdg. |
| 45Hz ≤ f ≤ 66Hz | ±0.1%rdg. ±0.05%f.s. | ±0.15%rdg. | ±0.15%rdg. |
| 66Hz < f ≤ 500Hz | ±0.1%rdg. ±0.1%f.s. | ±0.2%rdg. | ±0.2%rdg. |
| 500Hz < f ≤ 10kHz | ±0.1%rdg. ±0.2%f.s. | ±0.3%rdg. | ±0.3%rdg. |
| 10kHz < f ≤ 50kHz | ±0.5%rdg. ±0.3%f.s. | ±0.8%rdg. | ±0.8%rdg. |
| 50kHz < f ≤ 100kHz | ±2.1%rdg. ±0.3%f.s. | ±2.4%rdg. | ±2.4%rdg. |

Current (direct input)

| Frequency (f) | Input < 50% f.s. | 50%f.s. ≤ Input < 100%f.s. | 100%f.s. ≤ Input |
|---|---|---|---|
| DC | ±0.1%rdg. ±0.1%f.s. | ±0.1%rdg. ±0.1%f.s. | ±0.2%rdg. |
| 0.1Hz ≤ f < 16Hz | ±0.1%rdg. ±0.2%f.s. | ±0.3%rdg. | ±0.3%rdg. |
| 16Hz ≤ f < 45Hz | ±0.1%rdg. ±0.1%f.s. | ±0.2%rdg. | ±0.2%rdg. |
| 45Hz ≤ f ≤ 66Hz | ±0.1%rdg. ±0.05%f.s. | ±0.15%rdg. | ±0.15%rdg. |
| 66Hz < f ≤ 500Hz | ±0.1%rdg. ±0.1%f.s. | ±0.2%rdg. | ±0.2%rdg. |
| 500Hz < f ≤ 1kHz | ±0.1%rdg. ±0.2%f.s. | ±0.3%rdg. | ±0.3%rdg. |
| 1kHz < f ≤ 10kHz | ±(0.03+0.07×F)%rdg. ±0.2%f.s. | ±(0.23+0.07×F)%rdg. | ±(0.23+0.07×F)%rdg. |
| 10kHz < f ≤ 100kHz | ±(0.3+0.04×F)%rdg. ±0.3%f.s. | ±(0.6+0.04×F)%rdg. | ±(0.6+0.04×F)%rdg. |

Active power

| Frequency (f) | Input < 50% f.s. | 50%f.s. ≤ Input < 100%f.s. | 100%f.s. ≤ Input |
|---|---|---|---|
| DC | ±0.1%rdg. ±0.1%f.s. | ±0.1%rdg. ±0.1%f.s. | ±0.2%rdg. |
| 0.1Hz ≤ f < 16Hz | ±0.1%rdg. ±0.2%f.s. | ±0.3%rdg. | ±0.3%rdg. |
| 16Hz ≤ f < 45Hz | ±0.1%rdg. ±0.1%f.s. | ±0.2%rdg. | ±0.2%rdg. |
| 45Hz ≤ f ≤ 66Hz | ±0.1%rdg. ±0.05%f.s. | ±0.15%rdg. | ±0.15%rdg. |
| 66Hz < f ≤ 500Hz | ±0.1%rdg. ±0.1%f.s. | ±0.2%rdg. | ±0.2%rdg. |
| 500Hz < f ≤ 1kHz | ±0.1%rdg. ±0.2%f.s. | ±0.3%rdg. | ±0.3%rdg. |
| 1kHz < f ≤ 10kHz | ±(0.03+0.07×F)%rdg. ±0.2%f.s. | ±(0.23+0.07×F)%rdg. | ±(0.23+0.07×F)%rdg. |
| 10kHz < f ≤ 50kHz | ±(0.07×F)%rdg. ±0.3%f.s. | ±(0.3+0.07×F)%rdg. | ±(0.3+0.07×F)%rdg. |
| 50kHz < f ≤ 100kHz | ±(0.6+0.07×F)%rdg. ±0.3%f.s. | ±(0.9+0.07×F)%rdg. | ±(0.9+0.07×F)%rdg. |

- Values for f.s. depend on measurement ranges.
- "F" in the tables refers to the frequency in kHz.
- Add ±1mA to DC measurement accuracy for current.
- Add (±1mA) x (voltage read value) to DC measurement accuracy for active power.
- When using the 200mA or 500mA range, add ±0.1% rdg. to current and active power for which 1kHz < f ≤ 10kHz.
- Values for voltage, current, and active power for which 0.1Hz ≤ f < 10Hz are for reference only.
- Values for voltage, current, and active power in excess of 220V or 20A for which 10Hz ≤ f < 16Hz are for reference only.
- Values for current and active power in excess of 20A for which 500Hz < f ≤ 50kHz are for reference only.
- Values for current and active power in excess of 15A for which 50kHz < f ≤ 100kHz are for reference only.
- Values for voltage and active power in excess of 750V for which 30kHz < f ≤ 100kHz are for reference only.

| | |
|---|---|
| Guaranteed accuracy period | 1 year |
| Post-adjustment accuracy guaranteed | 6 months |
| Conditions of guaranteed accuracy | Temperature and humidity : 23°C ±5°C, 80% RH or less<br>Warm-up time : 30 minutes<br>Input : Sine wave input, power factor of 1, terminal-to-ground voltage of 0V, after zero adjustment; within range in which the fundamental wave satisfies synchronization source conditions |
| Temperature characteristic | ±0.03% f.s. per °C or less |
| Power factor effects | ±0.1% f.s. or less (45 to 66 Hz, at power factor = 0)<br>Internal circuitry voltage/current phase difference: ±0.0573° |
| Effect of common mode voltage | ±0.02% f.s. or less (600 V, 50/60 Hz, applied between input terminals and enclosure) |
| Effect of external magnetic field interference | 400 A/m, DC and 50/60 Hz magnetic field<br>Voltage :±1.5% f.s. or less<br>Current :±1.5% f.s. or ±10 mA, whichever is greater, or less<br>Active power :±3.0% f.s. or (voltage influence quantity) × (±10 mA), whichever is greater, or less |
| Magnetization effect | ±10 mA equivalent or less (after inputting 100 A DC to the current direct input terminals) |
| Adjacent channel input effect | ±10 mA equivalent or less (when inputting 50 A to adjacent channel) |

## Voltage/ Current/ Active Power Measurement Specifications

| | |
|---|---|
| Measurement types | Rectifiers: AC+DC, DC, AC, FND, AC+DC Umn |
| Effective measuring range | Voltage : 1% to 130% of range (however, up to ±1500 V peak value and 1000 V RMS value)<br>Current : 1% to 130% of range<br>Active power : 0% to 169% of the range (However, defined when the voltage and current fall within the effective measurement range.) |
| Display range | Voltage/ Current : 0.5% to 140% of range (zero-suppression when less than 0.5%)<br>Active power : 0% to 196% of the range (no zero-suppression) |
| Polarity | Voltage/ Current : Displayed when using DC rectifier<br>Active power +: Positive: Power consumption (no polarity display)<br>–: generation or regenerated power |

### Voltage/ Current/ Active power channel and sum value calculation formulas

| Wiring | | X: $U$ (Voltage) or $I$ (Current) | $P$ (Active power) |
|---|---|---|---|
| All channels | 1P2W | $X_{(i)}$ | $P_{(i)}$ |
| Sum values | 1P3W<br>3P3W | $X_{sum} = \frac{1}{2}(X_{(1)} + X_{(2)})$ | $P_{sum} = (P_{(1)} + P_{(2)})$ |
| | 3P3W2M<br>3V3A<br>3P3W3M<br>3P4W | $X_{sum} = \frac{1}{3}(X_{(1)} + X_{(2)} + X_{(3)})$ | $P_{sum} = (P_{(1)} + P_{(2)} + P_{(3)})$ |

( i ): Measurement channel

## Frequency Measurement Specifications

| | |
|---|---|
| Number of measurement channels | 3 |
| Measurement source | Select from U (VHz) or I (AHz) by channel |
| Measurement method | Calculated from input waveform period (reciprocal method) |
| Measurement range | 500 Hz/200 kHz (linked to zero-cross filter) |
| Measurement accuracy | ±0.1% rdg. ±1 dgt. (0°C to 40°C) |
| Effective measuring range | 0.1 Hz to 100 kHz<br>For sine wave input that is at least 20% of the measurement source's measurement range.<br>Measurement lower limit frequency setting: 0.1 sec. / 1 sec. / 10 sec. |
| Display format | 0.1000 Hz to 9.9999 Hz, 9.900 Hz to 99.999 Hz, 99.00 Hz to 999.99 Hz, 9900 kHz to 9.9999 kHz, 9.900 kHz to 99.999 kHz, 99.00 kHz to 220.00 kHz |

## Apparent Power/ Reactive Power/ Power Factor/ Phase Angle Measurement Specifications

| | |
|---|---|
| Measurement types | Rectifiers<br>Apparent Power/ Reactive Power/ Power Factor : AC+DC, AC, FND, AC+DC Umn<br>Phase Angle : AC, FND |
| Effective measuring range | As per voltage, current, and active power effective measurement ranges. |
| Display range | Apparent Power/ Reactive Power<br>: 0% to 196% of the range (no zero-suppression)<br>Power Factor<br>: ±0.0000 to ±1.0000<br>Phase Angle<br>: +180.00 to -180.00 |
| Polarity | Reactive Power/ Power Factor/ Phase Angle<br>Polarity is assigned according to the lead/lag relationship of the voltage waveform rising edge and the current waveform rising edge.<br>+ : When current lags voltage (no polarity display)<br>- : When current leads voltage |

### Power channel and sum value calculation formulas

| Wiring | | $S$ : Apparent power | $Q$ : Reactive power |
|---|---|---|---|
| All channels | 1P2W | $S_{(i)} = U_{(i)} \times I_{(i)}$ | $Q_{(i)} = si_{(i)}\sqrt{S_{(i)}^2 - P_{(i)}^2}$ |
| Sum values | 1P3W | $S_{sum} = S_{(1)} + S_{(2)}$ | $Q_{sum} = Q_{(1)} + Q_{(2)}$ |
| | 3P3W | $S_{sum} = \frac{\sqrt{3}}{2}(S_{(1)} + S_{(2)})$ | |
| | 3P3W2M<br>3V3A | $S_{sum} = \frac{\sqrt{3}}{3}(S_{(1)} + S_{(2)} + S_{(3)})$ | |
| | 3P3W3M<br>3P4W | $S_{sum} = S_{(1)} + S_{(2)} + S_{(3)}$ | $Q_{sum} = Q_{(1)} + Q_{(2)} + Q_{(3)}$ |

( i ): Measurement channel

| Wiring | | $\lambda$ : Power factor | $\phi$ : Phase angle |
|---|---|---|---|
| All channels | 1P2W | $\lambda_{(i)} = si_{(i)}\left\lvert\frac{P_{(i)}}{S_{(i)}}\right\rvert$ | $\phi_{(i)} = si_{(i)}\cos^{-1}\lvert\lambda_{(i)}\rvert$ |
| Sum values | 1P3W<br>3P3W<br>3P3W2M<br>3V3A<br>3P3W3M<br>3P4W | $\lambda_{sum} = si_{sum}\left\lvert\frac{P_{sum}}{S_{sum}}\right\rvert$ | When $P_{sum} \geq 0$<br>$\phi_{sum} = si_{sum}\cos^{-1}\lvert\lambda_{sum}\rvert$ (0° to ±90°)<br>When $P_{sum} \geq 0$<br>$\phi_{sum} = si_{sum}\lvert 180 - \cos^{-1}\lvert\lambda_{sum}\rvert\rvert$ (±90° to ±180°) |

( i ): Measurement channel ; The polarity symbol $si_{sum}$ is acquired from the $Q_{sum}$ symbol.

## Voltage Waveform Peak Value / Current Waveform Peak Value Measurement Specifications

| | |
|---|---|
| Measurement method | Measures the waveform's peak value (for both positive and negative polarity) based on sampled instantaneous voltage values. |
| Sampling frequency | Approx. 700 kHz |
| Range configuration | |
| Voltage peak range | |

| Voltage range | 15V | 30V | 60V | 150V | 300V | 600V | 1000V |
|---|---|---|---|---|---|---|---|
| Voltage peak range | 90.000V | 180.00V | 360.00V | 900.00V | 1.8000kV | 3.6000kV | 6.0000kV |

Current peak range

| Current range | 200mA | 500mA | 1A | 2A | 5A | 10A | 20A | 50A |
|---|---|---|---|---|---|---|---|---|
| Current peak range | 1.2000A | 3.0000A | 6.0000A | 12.000A | 30.000A | 60.000A | 120.00A | 300.00A |

| | |
|---|---|
| Measurement accuracy | Same as the voltage or current measurement accuracy at DC and when 10 Hz ≤ f ≤ 1 kHz (f.s.: voltage peak range or current peak range). Provided as reference value when 0.1 Hz ≤ f < 10 Hz and when in excess of 1 kHz. |
| Effective measuring range | ±5% to ±100% of voltage peak range (up to ±1500 V) or<br>±5% to ±100% of current peak range (up to ±100 A) |
| Display range | ±0.3% to ±102% of voltage peak range or current peak range (values less than ±0.3% are subject to zero-suppression) |

## Voltage Crest Factor/ Current Crest Factor Measurement Specifications

| | |
|---|---|
| Measurement method | Calculates values from display values once each display update interval for voltage and voltage waveform peak values or current and current waveform peak values. |
| Effective measuring range | As per voltage and voltage waveform peak value or current and current waveform peak value effective measurement ranges. |
| Display range | 1.0000 to 612.00 (no polarity) |

## Synchronized Control

| | |
|---|---|
| Functions | Timing of calculations, display updates, data updates, integration start/stop/reset events, display hold operation, key lock operation, and zero-adjustment operation for the slave PW3336/PW3337 are synchronized with the master PW3336/PW3337. |
| Terminal | BNC terminal × 1 (non-isolated) |
| Terminal name | EXT SYNC |
| I/O settings | Off: Synchronized control function off<br>In : The EXT SYNC terminal is set to input, and a dedicated synchronization signal can be input (slave).<br>Out: The EXT SYNC terminal is set to output, and a dedicated synchronization signal can be output (master). |
| Number of units for which synchronized control can be performed | 1 master unit and 7 slave units (total 8 units) |

## Voltage Ripple Rate / Current Ripple Factor Measurement Specifications

| | |
|---|---|
| Measurement method | Calculates the AC component (peak to peak [peak width]) as a proportion of the voltage or current DC component |
| Effective measuring range | As per voltage and voltage waveform peak value or current and current waveform peak value effective measurement ranges |
| Display range | 0.00[%] to 500.00[%] |
| Polarity | None |

## Efficiency Measurement Specifications

| | |
|---|---|
| Measurement method | Calculates the efficiency η [%] from the ratio of active power values for channels and wires |
| Wiring modes and calculation equations | Calculated based on the AC+DC rectifier active power |

PW3336 series

| Wiring (WIRING) | CH1 | CH2 | Calculation formulas |
|---|---|---|---|
| 1P2W × 2 | 1P2W | 1P2W | η1=100×\|P2\| / \|P1\|<br>η2=100×\|P1\| / \|P2\| |
| 1P3W | 1P3W | | |
| 3P3W | 3P3W | | |
| 3P3W2M | 3P3W2M | | |

PW3337 series

| Wiring (WIRING) | CH1 | CH2 | CH3 | Calculation formulas |
|---|---|---|---|---|
| 1P2W × 3 | 1P2W | 1P2W | 1P2W | η1=100×\|P3\| / \|P1\|<br>η2=100×\|P1\| / \|P3\| |
| 1P3W & 1P2W | 1P3W | | 1P2W | η1=100×\|P3\| / \|Psum\|<br>η2=100×\|Psum\| / \|P3\| |
| 3P3W & 1P2W | 3P3W | | 1P2W | |
| 3P3W2M | 3P3W2M | | | |
| 3V3A | 3V3A | | | |
| 3P3W3M | 3P3W3M | | | |
| 3P4W | 3P4W | | | |

| | |
|---|---|
| Effective measuring range | As per the active power effective measurement range. |
| Display range | 0.00[%] to 200.00[%] |

## Functional Specifications

| | |
|---|---|
| Auto-range (AUTO) | Automatically changes the voltage and current range for each wiring mode according to the input<br>Range up<br>: The range is increased when input exceeds 130% of the range or when the peak is exceeded.<br>Range down<br>: The range is decreased when input falls below 15% of the range. However, the range is not decreased when the peak is exceeded at the lower range. |
| Averaging (AVG) | · Averages the voltage, current, active power, apparent power, and reactive power.<br>· The power factor and phase angle are calculated from averaged data.<br>· Measured values other than peak values, power factor, frequency, integrated values, T.AV, crest factor, ripple rate, total harmonic distortion, and harmonics are averaged.<br>Method : Simple averaging<br>Number of averaging iterations and display update interval |

| Number of averaging iterations | 1 (OFF) | 2 | 5 | 10 | 25 | 50 | 100 |
|---|---|---|---|---|---|---|---|
| Display update interval | 200ms | 400ms | 1s | 2s | 5s | 10s | 20s |

| | |
|---|---|
| Scaling (VT, CT) | Applies user-defined VT and CT ratio settings to measured values. These settings can be configured separately for each wiring mode.<br>VT ratio setting range : OFF (1.0), 0.1 to 1000 (setting: 0000)<br>CT ratio setting range : OFF (1.0), 0.001 to 1000 (setting: 0000) |
| HOLD (HOLD) | · Stops display updates for all measured values and fixes the display values at that point in time.<br>· Measurement data acquired by communications is also fixed at that point in time.<br>· Internal calculations (including integration and integration elapsed time) will continue.<br>· Analog output and waveform output are not held. |
| Maximum value/ minimum value hold (MAX/MIN HOLD) | · Detects maximum and minimum measured values as well as maximum and minimum values for the voltage and current waveform peak and holds them on the display.<br>· For data with polarity, display of the maximum value and minimum value for the data's absolute values is held (so that both positive and negative polarity values are shown).<br>· Internal calculations (including integration and integration elapsed time) will continue.<br>· Analog output and waveform output are not held. |
| Zero Adjustment (0 ADJ) | Degausses the current input unit DCCT and then zeroes out the current input offset. |
| Key-lock (KEY LOCK) | Disables key input in the measurement state, except for the SHIFT key and KEY LOCK key. |
| Backup | Backs up settings and integration data if the instrument is turned off and if a power outage occurs. |
| System Reset | · Initializes the instrument's settings.<br>· Communications-related settings (communications speed, address, and LAN-related settings) are not initialized. |

## Integration Measurement Specifications

| | |
|---|---|
| Measurement types | Rectifiers: AC+DC, AC+DC Umn<br>Current:<br>Displays the result of integrating current RMS value data (display values) once every display update interval (approx. 200 ms) as an integrated value.<br>Active power:<br>Displays the result of integrating active power values by polarity calculated once every cycle for the selected synchronization source as integrated values.<br>Rectifier: DC<br>Displays the result of integrating instantaneous data obtained by sampling both current and active power by polarity as integrated values (When the active power contains both AC and DC, the DC component will not be integrated) |

## Integration Measurement Specifications

| | |
|---|---|
| Measurement items | Simultaneous integration of the following 6 parameters for each channel (total of 18 parameters):<br>Sum of current integrated values (displayed as Ah on panel display)<br>Positive current integrated value (displayed as Ah+ on panel display)<br>Negative current integrated value (displayed as Ah- on panel display)<br>Sum of active power integrated values (displayed as Wh on panel display)<br>Positive active power integrated value (displayed as Wh+ on panel display)<br>Negative active power integrated value (displayed as Wh- on panel display) |
| Integration time | 1 min. to 10000 hr., settable in 1 min. blocks |
| Integration time accuracy | ±100 ppm ±1 dgt. (0°C to 40°C) |
| Integration measurement accuracy | (Current or active power measurement accuracy) + (±0.01% rdg. ±1 dgt.) |
| Effective measuring range | Until PEAK OVER U or PEAK OVER I occurs |
| Display resolution | 999999 (6 digits + decimal point) |
| Functions | · Stopping integration based on integration time setting (timer)<br>· Displaying the integration elapsed time (displayed as TIME on panel display)<br>· Additional integration by repeatedly starting/stopping integration<br>· Backing up integrated values and the integration elapsed time during power outages<br>· Stopping integration when power returns |
| External control | Stopping/starting integration and resetting integrated values based on external control |
| Measuring range | Corresponds to the range set for START integretation |

## Time Average Current / Time Average Active Power Measurement Specifications (T.AV)

| | |
|---|---|
| Measurement method | Calculates the average by dividing the integrated value by the integration time |
| Measurement accuracy | ±(Current or active power measurement accuracy) ±(±0.01%rdg. ±1dgt.) |
| Effective measuring range | As per the current or active power effective measurement range |

## Harmonic Measurement Specifications (built-in function)

| | |
|---|---|
| Measurement method | · Zero-cross simultaneous calculation method (separate windows by channel according to the wiring mode)<br>· Uniform thinning between zero-cross events after processing with a digital antialiasing filter<br>· Interpolation calculations (Lagrange interpolation)<br>· When the synchronization frequency falls within the 45 Hz to 66 Hz range<br>» IEC 61000-4-7:2002 compliant<br>» Gaps and overlaps may occur if the measurement frequency is not 50 Hz or 60 Hz<br>· When the synchronization frequency falls outside the 45 Hz to 66 Hz range<br>» No gaps or overlap will occur |
| Synchronization source | Conforms to synchronization source (SYNC) for the basic measurement specifications |
| Measurement channels | 3 |
| Measurement items | ·Harmonic voltage RMS value ·Harmonic voltage content %<br>·Harmonic voltage phase angle ·Harmonic current RMS value<br>·Harmonic current content % ·Harmonic current phase angle<br>·Harmonic active power ·Harmonic active power content %<br>·Harmonic voltage current phase difference ·Total harmonic voltage distortion<br>·Total harmonic current distortion ·Voltage fundamental waveform<br>·Current fundamental waveform · Active power fundamental waveform<br>·Apparent power fundamental waveform · Reactive power fundamental waveform<br>·Power factor fundamental waveform<br>·Voltage current phase difference fundamental waveform<br>·Interchannel voltage fundamental wave phase difference<br>·Interchannel current fundamental wave phase difference<br>The following parameters can be downloaded as data during PC communication but not displayed:<br>· Harmonic voltage phase angle · Harmonic current phase angle<br>· Harmonic voltage current phase difference |
| FFT processing word length | 32 bits |
| Number of FFT points | 4096 |
| Window function | Rectangular |
| Analysis window width | 45 Hz ≤ f < 56 Hz 178.57 ms to 222.22 ms (10 cycles)<br>56 Hz ≤ f < 66 Hz 181.82 ms to 214.29 ms (12 cycles)<br>Frequencies other than the above 185.92 ms to 214.08 ms |
| Data update rate | Depends on window width |
| Synchronization frequency range | 10 Hz to 640 Hz |
| Maximum analysis order | |

| Synchronization frequency (f) range | Analysis order |
|---|---|
| 10 Hz ≤ f < 45 Hz | 50th |
| 45 Hz ≤ f < 56 Hz | 50th |
| 56 Hz ≤ f ≤ 66 Hz | 50th |
| 66 Hz < f ≤ 100 Hz | 50th |
| 100 Hz < f ≤ 200 Hz | 40th |
| 200 Hz < f ≤ 300 Hz | 25th |
| 300 Hz < f ≤ 500 Hz | 15th |
| 500 Hz < f ≤ 640 Hz | 11th |

| | |
|---|---|
| Analysis order upper limit setting | 2nd to 50th |
| Measurement accuracy | f.s.: Measurement range |

| Frequency (f) | Voltage, Current, Active power |
|---|---|
| DC | ±0.4%rdg.±0.2%f.s. |
| 10 Hz ≤ f < 30 Hz | ±0.4%rdg.±0.2%f.s. |
| 30 Hz ≤ f ≤ 400 Hz | ±0.3%rdg.±0.1%f.s. |
| 400 Hz < f ≤ 1 kHz | ±0.4%rdg.±0.2%f.s. |
| 1 kHz < f ≤ 5 kHz | ±1.0%rdg.±0.5%f.s. |
| 5 kHz < f ≤ 8 kHz | ±4.0%rdg.±1.0%f.s. |

For DC, add ±1 mA to current and (±1 mA) × (voltage read value) to active power.

## Display Specifications

| | |
|---|---|
| Display | 7-segment LED |
| Number of display parameters | 4 |
| Display resolution | Other than integrated values: 99999 count<br>Integrated values: 999999 count |
| Display update rate | 200 ms ±50 ms (approx. 5 updates per sec.) to 20 s (varies with number of averaging iterations setting) |

## External Current Sensor Input Specifications (built-in feature)

| | |
|---|---|
| Terminal | Isolated BNC terminals, 1 for each channel |
| Current sensor type switching | Off / Type 1 / Type 2<br>When set to off, input from the external current sensor input terminal is ignored. |
| Current sensor options | TYPE1 (100 A to 5000 A sensors)<br>9660, 9661, 9669, CT9667-01/-02/-03<br><br>TYPE2 (20 A to 1000 A sensors, Power supply is required to use)<br>CT6862-05, CT6863-05, 9709-05, CT6865-05, 9272-05,<br>CT6841-05, CT6843-05, CT6844-05, CT6845-05, CT6846-05 |
| Current measurement range | Auto / 10 A / 20 A / 50 A (range noted on panel)<br>User-selectable for each wiring mode. Can be read directly by manually setting the CT ratio. |
| Power range configuration | Depends on the combination of voltage and current ranges; from 60.000W to 15.000MW (also applies to VA, var) |
| Measurement accuracy | |

Current, Active power

| Frequency | Input < 50%f.s. | 50%f.s. ≤ Input < 100%f.s. | 100%f.s. ≤ Input |
|---|---|---|---|
| DC | ±0.2%rdg. ±0.6%f.s. | ±0.2%rdg. ±0.6%f.s. | ±0.8%rdg. |
| 0.1Hz≤ f <16Hz | ±0.2%rdg. ±0.2%f.s. | ±0.4%rdg. | ±0.4%rdg. |
| 16Hz≤ f < 45Hz | ±0.2%rdg. ±0.2%f.s. | ±0.4%rdg. | ±0.4%rdg. |
| 45Hz ≤ f ≤ 66Hz | ±0.2%rdg. ±0.1%f.s. | ±0.3%rdg. | ±0.3%rdg. |
| 66Hz < f ≤ 500Hz | ±0.2%rdg. ±0.2%f.s. | ±0.4%rdg. | ±0.4%rdg. |
| 500Hz < f ≤ 1kHz | ±0.2%rdg. ±0.3%f.s. | ±0.5%rdg. | ±0.5%rdg. |
| 1kHz < f ≤ 10kHz | ±5.0%rdg. | ±5.0%rdg. | ±5.0%rdg. |
| 10kHz < f ≤ 50kHz | | | |
| 50kHz < f ≤ 100kHz | | | |

f.s. : Each measurement range
- To obtain the current or active power accuracy, add the current sensor's accuracy to the above current and active power accuracy figures.
- The effective measurement range and frequency characteristics conform to the current sensor's specifications.
- Values for current, and active power for which 0.1 Hz ≤ f < 10 Hz are for reference only.
- Values for voltage in excess of 220 V active power for which 10 Hz ≤ f < 16 Hz are for reference only.

| | |
|---|---|
| Temperature characteristics | Current, active power<br>: ±0.08% f.s./°C (instrument temperature coefficient; f.s.: instrument measurement range)<br>Add current sensor temperature coefficient to above. |
| Power factor effects | · Instrument: ±0.15% f.s. or less (45 Hz to 66 Hz with power factor = 0)<br>· Internal circuit voltage/current phase difference: ±0.086°<br>· Add the current sensor phase accuracy to the internal circuit voltage/current phase difference noted above. |
| Current peak value measurement accuracy | · (External current sensor input instrument accuracy) + (±2.0% f.s.) (f.s.:current peak range)<br>· Add the current sensor accuracy to the above. |
| Harmonic measurement accuracy | |

| Frequency | Voltage | Current, Active power |
|---|---|---|
| DC | ±0.4%rdg. ±0.2%f.s. | ±0.6%rdg. ±0.8%f.s. |
| 10Hz≤ f < 30Hz | ±0.4%rdg. ±0.2%f.s. | ±0.6%rdg. ±0.4%f.s. |
| 30Hz≤ f ≤ 400Hz | ±0.3%rdg. ±0.1%f.s. | ±0.5%rdg. ±0.3%f.s. |
| 400Hz < f ≤ 1kHz | ±0.4%rdg. ±0.2%f.s. | ±0.6%rdg. ±0.5%f.s. |
| 1kHz < f ≤ 5kHz | ±1.0%rdg. ±0.5%f.s. | ±1.0%rdg. ±5.5%f.s. |
| 5kHz < f ≤ 8kHz | ±4.0%rdg. ±1.0%f.s. | ±2.0%rdg. ±6.0%f.s. |

f.s.: Each measurement range
- To obtain the current or active power accuracy, add the current sensor's accuracy to the above current and active power accuracy figures.

## D/A Output Specifications (PW3336-02/-03 and PW3337-02/-03)

| | |
|---|---|
| Number of output channels | 16 |
| Configuration | 16-bit D/A converter (polarity + 15 bits) |
| Output parameters | U1 to U3 (voltage level) or u1 to u3 (instantaneous voltage waveform) (switchable)<br>I1 to I3 (current level) or i1 to i3 (instantaneous current waveform) (switchable)<br>P1 to P3 (active power level) or p1 to p3 (instantaneous power waveform) (switchable)<br>Psum (active power level) or Hi-Psum (high-speed active power level) (switchable)<br>Psum and Hi-Psum output is not available (0 V) when using the 1P2W wiring mode.P12 is output when using 1P3W, 3P3W, or 3P3W2M, and P123 is output when using 3V3A, 3P3W3M, or 3P4W.<br>D/A1 to D/A3<br>: Select any 3 from channel or sum value for voltage, current, active power, apparent power, reactive power, power factor, phase angle, total harmonic voltage/current distortion, inter-channel voltage/current fundamental wave phase difference, voltage/current crest factor, time average current/active power, voltage/current ripple rate, frequency, efficiency, current integration, active power integration (harmonic output is not available for individual orders).<br>Hi-P1 to Hi-P3 and Hi-Psum (high-speed active power level): Fixed to AC+DC<br>For other level output, select AC+DC, AC+DC Umn, DC, AC, or fnd. |
| Output accuracy | f.s.: Relative to the output voltage rated value for each output parameter<br>Level output<br>: (Output parameter measurement accuracy) + (±0.2% f.s.)<br>High-speed active power level output<br>: (Output parameter measurement accuracy) + (±0.2% f.s.)<br>Instantaneous waveform output<br>: (Output parameter measurement accuracy) + (±1.0% f.s.)<br>Instantaneous voltage, instantaneous current: RMS value level<br>Instantaneous power: Average value level |
| Output frequency band | Instantaneous waveform output, high-speed active power level output<br>At DC or 10 Hz to 5 kHz, accuracy is as defined above. |
| Output voltage | Level output<br>Voltage, current, active power, apparent power, reactive power, time average current/active power<br>: ±2 V DC for ±100% of range<br>Power factor<br>: ±2 V DC at ±0.0000, 0 V DC at ±1.0000<br>Phase angle<br>: 0 V DC at 0.00°, ±2 V DC at ±180.00°<br>Voltage/current ripple rate, total harmonic voltage/current distortion<br>: + 2 V DC at 100.00%<br>Voltage/current crest factor<br>: +2 V DC at 10.000<br>Frequency<br>: Varies with measured value.<br>+2 V DC per 100 Hz from 0.1000 Hz to 300.00 Hz<br>+2 V DC per 10 kHz from 300.01 Hz to 30.000 kHz<br>+2 V DC per 100 kHz from 30.001 kHz to 220.00 kHz<br>Efficiency<br>: +2 V DC at 200.00%<br>Current integration, active power integration<br>: ±5 V DC at (range) × (integration set time)<br>Waveform output<br>: 1 V f.s. relative to 100% of range |
| Maximum output voltage | Approx. ±12 V DC |
| Output update rate | Level output<br>: Fixed at 200 ms ±50 ms (approx. 5 times per sec.)<br>Update rate is unrelated to number of averaging iterations setting and display hold operation.<br>Waveform output<br>: Approx. 11.4 µs (approx. 87.5 kHz)<br>High-speed P level<br>: Updated once every cycle for the input waveform set as the synchronization source. |
| Response time | Level output<br>: 0.6 sec. or less (when the input changes abruptly from 0% to 90%, or from 100% to 10%, the time required in order to satisfy the accuracy range)<br>Waveform output<br>: 0.2 ms or less<br>High-speed active power level output<br>: 1 cycle |
| Temperature characteristic | ±0.05% f.s./°C or less |
| Output resistance | 100 Ω ±5 Ω |

## External control (built-in feature)

| | |
|---|---|
| Functions | Integration start/stop, integration reset and hold via external control |
| External control | Input signal level: 0 to 5 V (high-speed CMOS level or shorted [Lo]/open [Hi]) |

| Functions | External control signal | External control terminal |
|---|---|---|
| Start | Hi → Lo | START/STOP |
| Stop | Lo → Hi | |
| Reset | Lo interval of at least 200 ms | RESET |
| Hold on | Hi → Lo | HOLD |
| Hold off | Lo → Hi | |

## GP-IB interface (PW3336-01/-03, PW3337-01/-03)

| | |
|---|---|
| Method | IEEE488.1 1978 compliant; see IEEE488.2 1987<br>Interface functions: SH1, AH1, T6, L4, SR1, RL1, PP0, DC1, DT1, C0<br>Remote control by controller |
| Address | 00 to 30 |

## RS-232C interface (built-in feature)

| | |
|---|---|
| Connector | D-sub 9-pin connector × 1 |
| Communication method | Full duplex, Start-stop synchronization, Stop bits: 1 (fixed),<br>Data bits: 8 (fixed), Parity: None<br>Remote control by controller |
| Communication Speed | 9600bps/ 38400bps |

## LAN interface (built-in feature)

| | |
|---|---|
| Connector | RJ-45 connector × 1 |
| Electrical Specifications | IEEE802.3 compliant |
| Transmission Method | 10BASE-T/100BASE-TX (automatic detection) |
| Protocol | TCP/IP |
| Functions | HTTP server (remote operation, firmware updates)<br>Dedicated ports (command control, data transfer)<br>Remote control by controller (REMOTE lamp will light up.) |

## General Specifications (product guaranteed for one year)

| | |
|---|---|
| Operating environment | Indoors, altitude up to 2000 m (6562-ft.), pollution degree 2 |
| Operating temperature and humidity | 0 to 40°C (32 to 104°F), 80% RH or less (non-condensating) |
| Storage temperature and humidity | -10 to 50°C (14 to 122°F) 80% RH or less (non-condensating) |
| Dielectric strength | 4290 Vrms AC (sensed current: 1 mA)<br>Between voltage input terminals and (case, interface, and output terminals)<br>Between current direct input terminals and (case, interface, and output terminals)<br>Between voltage input terminals and current direct input terminals |
| Maximum rated voltage to earth | Voltage input terminal, Current direct input terminal<br>Measurement category III 600 V (anticipated transient overvoltage 6000 V)<br>Measurement category II 1000 V (anticipated transient overvoltage 6000 V) |
| Maximum input voltage | Between voltage input terminals U: 1000 V, ±1500 Vpeak |
| Maximum input current | Between +/- current direct input terminals I: ±70 A, ±100 Apeak |
| Applicable Standards | Safety : EN61010, EMC : EN61326 Class A/ EN61000-3-2/ EN61000-3-3 |
| Rated supply voltage | 100 VAC to 240 VAC, Rated power supply frequency : 50/60 Hz |
| Maximum rated power | 40 VA or less |
| Dimensions | Approx. 305W(12.01") × 132H(5.20") × 256D(10.08") mm<br>(excluding protrusions) |
| Mass | PW3336 series Approx. 5.2 kg (183.4 oz.)<br>PW3337 series Approx. 5.6 kg (197.5 oz.) |
| Accessories | Instruction manual × 1, Measurement guide × 1, Power cord × 1 |

## Current Measurement Options [Type 1] Specifications (Can be connected to the current sensor input terminals on the PW3336/PW3337 series.)

| Model | CLAMP ON SENSOR 9660 | CLAMP ON SENSOR 9661 | CLAMP ON SENSOR 9669 | FLEXIBLE CLAMP ON SENSOR CT9667-01 | FLEXIBLE CLAMP ON SENSOR CT9667-02 | FLEXIBLE CLAMP ON SENSOR CT9667-03 |
|---|---|---|---|---|---|---|
| Appearance |  |  |  |  |  |  |
| Primary current rating | 100A AC | 500A AC | 1000 A AC | 500A/ 5000A AC | | |
| Measurable conductor diameter | Max.ϕ15mm (0.59") | Max.ϕ46mm (1.81") | Max. ϕ55 mm(2.17"), 80 (3.15")×20(0.79") mm busbar | Max. ϕ100mm (3.94") | Max. ϕ180mm (7.09") | Max. ϕ254mm(10.0") |
| Basic accuracy | ±0.3%rdg.±0.02%f.s. (amplitude) ±1° or less (phase) (At 45 Hz to 66 Hz) | ±0.3%rdg.±0.01%f.s. (amplitude) ±0.5° or less (phase) (At 45 Hz to 66 Hz) | ±1.0%rdg.±0.01%f.s. (amplitude) ±1° or less (phase) (At 45 Hz to 66 Hz) | ±2.0%rdg.±0.3%f.s. (amplitude) ±1° or less (At 45 Hz to 66 Hz) | | |
| Frequency characteristics | ±1.0% or less (At 40Hz to 5kHz ) | | ±2% or less (At 40Hz to 5kHz) | ±3dB or less (At 10 Hz to 20kHz) | | |
| Operating Temperature | 0 to 50°C (32 to 122°F), | | | -25 to 65°C (-13 to 149°F) | | -10 to 50°C (14 to 122°F) |
| Effect of conductor position | Within ±0.5% (deviation from center) | | Within ±1.5% (deviation from center) | Within ±3% (deviation from center) | | |
| Effect of external electromagnetic field | 0.1A equivalent or lower (400A/m,55Hz) | | 1A equivalent or lower (400A/m, 55Hz) | 1.5% f.s. or lower (400A/m, 55Hz) | | |
| Maximum rated voltage to earth | CAT III 300Vrms | | CATIII 600Vrms | CATIII 1000 Vrms, CATIV 600 Vrms | | |
| Dimensions | 46W(1.81")×135H(5.31") ×21D(0.83")mm Cable length: 3 m (9.84 ft) | 78W(3.07")×152H(5.98") ×42D(1.65")mm Cable length: 3 m (9.84 ft) | 99.5W (3.92") × 188H (7.40") × 42D (1.65") mm Cable length: 3 m (9.84 ft) | Circuit box: 35W (1.38") × 120.5H (4.74") × 34D (1.34") mm, Cable length: 2m (between flexible loop and circuit box), 1m (output cable) | | |
| Mass | 230g(8.1oz.) | 380g(13.4oz.) | 590g (20.8 oz.) | 280 g (9.9oz.) | 280 g (9.9oz.) | 470 g (4.9 oz.) |
| Power supply | — | — | — | LR6 alkaline battery x2, or AC Adapter 9445-02/ 9445-03 (sold separately) | | |

## Current Measurement Options [Type 2] Specifications (Requires Sensor Unit CT9555 or CT9557, and Connection Cable L9217.)

| Model | AC/DC CURRENT PROBE CT6841-05 | AC/DC CURRENT PROBE CT6843-05 | AC/DC CURRENT PROBE CT6844-05 | AC/DC CURRENT PROBE CT6845-05 | AC/DC CURRENT PROBE CT6846-05 |
|---|---|---|---|---|---|
| Appearance |  |  |  |  |  |
| Rated primary current | 20 A AC/DC | 200 A AC/DC | 500 A AC/DC | 500 A AC/DC | 1000 A AC/DC |
| Frequency band | DC to 1 MHz | DC to 500 kHz | DC to 200 kHz | DC to 100 kHz | DC to 20 kHz |
| Diameter of measurable conductors | Max.φ 20 mm (0.79") (insulated conductor) | Max.φ 20 mm (0.79") (insulated conductor) | Max.φ 20 mm (0.79") (insulated conductor) | Max.φ 50 mm (1.97") (insulated conductor) | Max.φ 50 mm (1.97") (insulated conductor) |
| Basic accuracy (At DC) | ±0.3% rdg. ±0.05% f.s. (amplitude) | ±0.3% rdg. ±0.02% f.s.(amplitude) | ±0.3% rdg. ±0.02% f.s. (amplitude) | ±0.3% rdg. ±0.02% f.s. (amplitude) | ±0.3% rdg. ±0.02% f.s. (amplitude) |
| Basic accuracy (At DC < f ≤ 100 Hz) | ±0.3% rdg. ±0.01% f.s. (amplitude) ±0.1° (phase) | ±0.3% rdg. ±0.01% f.s. (amplitude) ±0.1° (phase) | ±0.3% rdg. ±0.01% f.s. (amplitude) ±0.1° (phase) | ±0.3% rdg. ±0.01% f.s. (amplitude) ±0.1° (phase) | ±0.3% rdg. ±0.01% f.s. (amplitude) ±0.1° (phase) |
| Frequency characteristics (Amplitude) | to 500 Hz: ±0.3% rdg. ±0.02% f.s.<br>to 1 kHz: ±0.5% rdg. ±0.02% f.s.<br>to 10 kHz: ±1.5% rdg. ±0.02% f.s.<br>to 100 kHz: ±5.0% rdg. ±0.05% f.s.<br>to 1 MHz: ±30% rdg. ±0.05% f.s.<br>(Includes derating characteristics) | to 500 Hz: ±0.3% rdg. ±0.02% f.s.<br>to 1 kHz: ±0.5% rdg. ±0.02% f.s.<br>to 10 kHz: ±1.5% rdg. ±0.02% f.s.<br>to 50 kHz: ±5.0% rdg. ±0.02% f.s.<br>to 500 kHz: ±30% rdg. ±0.05% f.s.<br>(Includes derating characteristics) | to 500 Hz: ±0.3% rdg. ±0.02% f.s.<br>to 1 kHz: ±0.5% rdg. ±0.02% f.s.<br>to 10 kHz: ±1.5% rdg. ±0.02% f.s.<br>to 50 kHz: ±5.0% rdg. ±0.02% f.s.<br>to 200 kHz: ±30% rdg. ±0.05% f.s.<br>(Includes derating characteristics) | to 500 Hz: ±0.3% rdg. ±0.02% f.s.<br>to 1 kHz: ±0.5% rdg. ±0.02% f.s.<br>to 10 kHz: ±1.5% rdg. ±0.02% f.s.<br>to 20 kHz: ±5.0% rdg. ±0.02% f.s.<br>to 100 kHz: ±30% rdg. ±0.05% f.s.<br>(Includes derating characteristics) | to 500 Hz: ±0.5% rdg. ±0.02% f.s.<br>to 1 kHz: ±1.0% rdg. ±0.02% f.s.<br>to 5 kHz: ±2.0% rdg. ±0.02% f.s.<br>to 10 kHz: ±5.0% rdg. ±0.05% f.s.<br>to 20 kHz: ±30% rdg. ±0.10% f.s.<br>(Includes derating characteristics) |
| Operating Temperature | -40°C to 85°C (-40°F to 185°F) | -40°C to 85°C (-40°F to 185°F) | -40°C to 85°C (-40°F to 185°F) | -40°C to 85°C (-40°F to 185°F) | -40°C to 85°C (-40°F to 185°F) |
| Effect of conductor position | Within ±0.1% rdg. (DC to 100 Hz) | Within ±0.1% rdg. (DC to 100 Hz) | Within ±0.1% rdg. (DC to 100 Hz) | Within ±0.2% rdg. (DC to 100 Hz) | Within ±0.2% rdg. (50/ 60 Hz) |
| Effect of external magnetic fields | 50 mA equivalent or lower (400 A/m, 60 Hz and DC) | 50 mA equivalent or lower (400 A/m, 60 Hz and DC) | 100 mA equivalent or lower (400 A/m, 60 Hz and DC) | 150 mA equivalent or lower (400 A/m, 60 Hz and DC) | 150 mA equivalent or lower (400 A/m, 60 Hz and DC) |
| Dimensions | 153W (6.02") × 67H (2.64") × 25D (0.98") mm Cable length: 3 m (9.84 ft) | 153W (6.02") × 67H (2.64") × 25D (0.98") mm Cable length: 3 m (9.84 ft) | 153 (6.02") W × 67 (2.64") H × 25 (0.98") D mm Cable length: 3 m (9.84 ft) | 238 (9.37") W × 116 (4.57") H × 35 (1.38") D mm Cable length: 3 m (9.84 ft) | 238 (9.37") W × 116 (4.57") H × 35 (1.38") D mm Cable length: 3 m (9.84 ft) |
| Mass | 350 g (12.3 oz) | 370 g (13.1 oz) | 400 g (14.1 oz) | 860 g (30.3 oz) | 990 g (34.9) |
| Power supply | SENSOR UNIT CT9555 or CT9557 | SENSOR UNIT CT9555 or CT9557 | SENSOR UNIT CT9555 or CT9557 | SENSOR UNIT CT9555 or CT9557 | SENSOR UNIT CT9555 or CT9557 |

| Model | AC/DC CURRENT SENSOR CT6862-05 | AC/DC CURRENT SENSOR CT6863-05 | AC/DC CURRENT SENSOR 9709-05 | AC/DC CURRENT SENSOR CT6865-05 | CLAMP ON SENSOR 9272-05 |
|---|---|---|---|---|---|
| Appearance |  |  |  |  |  |
| Rated primary current | 50 A AC/DC | 200 A AC/DC | 500 A AC/DC | 1000 A AC/DC | 20A/200A AC |
| Frequency band | DC to 1 MHz | DC to 500 kHz | DC to 100 kHz | DC to 20 kHz | 1 Hz to 100 kHz |
| Diameter of measurable conductors | Max.φ 24mm (0.94") | Max.φ 24 mm (0.94") | Max.φ 36 mm (1.42") | Max.φ 36 mm (1.42") | Max.ϕ 46mm (1.81") |
| Basic accuracy | ±0.05 % rdg.±0.01 % f.s. (amplitude) ±0.2° (phase, not defined for DC) (At DC and 16 Hz to 400 Hz) | ±0.05 % rdg.±0.01 % f.s. (amplitude) ±0.2° (phase, not defined for DC) (At DC and 16 Hz to 400 Hz) | ±0.05 % rdg.±0.01 % f.s. (amplitude) ±0.2° (phase, not defined for DC) (At DC and 45 Hz to 66 Hz) | ±0.05 % rdg.±0.01 % f.s. (amplitude) ±0.2° (phase, not defined for DC) (At DC and 16 Hz to 66 Hz) | ±0.3 % rdg.±0.01 % f.s. (amplitude) ±0.2° (phase) (At 45 Hz to 66 Hz) |
| Frequency characteristics (Amplitude) | to 16 Hz: ±0.1% rdg. ±0.02% f.s.<br>400Hz to 1kHz: ±0.2% rdg. ±0.02% f.s.<br>to 50 kHz: ±1.0% rdg. ±0.02% f.s.<br>to 100 kHz: ±2.0% rdg. ±0.05% f.s.<br>to 1 MHz: ±30% rdg. ±0.05% f.s.<br>(Includes derating characteristics) | to 16 Hz: ±0.1% rdg. ±0.02% f.s.<br>400Hz to 1kHz: ±0.2% rdg. ±0.02% f.s.<br>to 10 kHz: ±1.0% rdg. ±0.02% f.s.<br>to 100 kHz: ±5.0% rdg. ±0.05% f.s.<br>to 500 kHz: ±30% rdg. ±0.05% f.s.<br>(Includes derating characteristics) | to 45 Hz: ±0.2% rdg. ±0.02% f.s.<br>66 Hz to 500 Hz:±0.2% rdg. ±0.02% f.s.<br>to 5 kHz: ±0.5% rdg. ±0.05% f.s.<br>to 10 kHz: ±5.0% rdg. ±0.10% f.s.<br>to 100 kHz: ±30% rdg. ±0.10% f.s.<br>(Includes derating characteristics) | to 16 Hz: ±0.1% rdg. ±0.02% f.s.<br>66 Hz to 100 Hz:±0.5% rdg. ±0.02% f.s.<br>to 500 Hz: ±1.0% rdg. ±0.02% f.s.<br>to 5 kHz: ±5.0% rdg. ±0.05% f.s.<br>to 20 kHz: ±30% rdg. ±0.1% f.s.<br>(Includes derating characteristics) | 1 Hz to 10Hz: ±2.0% rdg. ±0.10% f.s.<br>to 45Hz: ±0.5% rdg. ±0.02% f.s.<br>66Hz to 5kHz: ±1.0% rdg. ±0.05% f.s.<br>to 50kHz: ±5.0% rdg. ±0.10% f.s.<br>to 100kHz: ±30% rdg. ±0.10% f.s.<br>(Includes derating characteristics) |
| Operating Temperature | -30°C to 85°C (-22°F to 185°F) | -30°C to 85°C (-22°F to 185°F) | 0°C to 50°C (32°F to 122°F) | -30°C to 85°C (-22°F to 185°F) | 0°C to 50°C (-32°F to 122°F) |
| Effect of conductor position | Within ±0.01% rdg. (DC to 100 Hz) | Within ±0.01% rdg. (DC to 100 Hz) | Within ±0.05% rdg. (DC) | Within ±0.05% rdg. (50/60 Hz) | Within ±0.2%rdg. (55Hz) |
| Effect of external magnetic fields | 10 mA equivalent or lower (400 A/m, 60 Hz and DC) | 50 mA equivalent or lower (400 A/m, 60 Hz and DC) | 50 mA equivalent or lower (400 A/m, 60 Hz and DC) | 200 mA equivalent or lower (400 A/m, 60 Hz and DC) | 100 mA equivalent or lower (400 A/m, 60 Hz) |
| Dimensions | 70W (2.76") × 100H (3.94") × 53D (2.09") mm Cable length: 3 m (9.84 ft) | | 160W (6.30") × 112H (4.41") × 50D (1.97") mm Cable length: 3 m (9.84 ft) | | 78W(3.07")×188H(7.40")×35D(1.38")mm Cable length: 3 m (9.84 ft) |
| Mass | 340 g (12.0 oz.) | 350 g (12.3 oz.) | 850 g (30.0 oz.) | 980 g (35.3 oz) | 430g (15.2 oz.) |
| Power supply | SENSOR UNIT CT9555 or CT9557 | SENSOR UNIT CT9555 or CT9557 | SENSOR UNIT CT9555 or CT9557 | SENSOR UNIT CT9555 or CT9557 | SENSOR UNIT CT9555 or CT9557 |

## Type 2 Current Sensor Options

| | SENSOR UNIT CT9555 | SENSOR UNIT CT9557 |
|---|---|---|
| Appearance |  |  With additive output function |
| Number of available sensors | 1 | 4 |
| Compatible current sensors | CT6862-05, CT6863-05, 9709-05, CT6865-05, 9272-05, CT6841-05, CT6843-05, CT6844-05, CT6845-05, CT6846-05 | |
| Power supply | 100 to 240 V AC | |

| | Connection Cord L9217 |
|---|---|
| Appearance |  |
| Cord length | 1.6 m (5.25 ft) length |
| Terminals | Isolated BNC to isolated BNC |

## Type 2 Current Sensor Connection Diagram

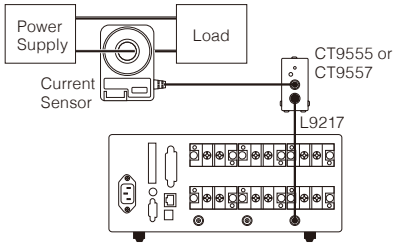

## Model : POWER METER PW3336

LAN RS-232C GP-IB -01/-03 Model CE True RMS

| Model No. (Order Code) | (Note) |
|---|---|
| PW3336 | (2ch) |
| PW3336-01 | (2ch, with GP-IB) |
| PW3336-02 | (2ch, with D/A output) |
| PW3336-03 | (2ch, with GP-IB, D/A output) |

Accessories: Instruction manual ×1, Measurement guide ×1, Power cord ×1

## Model : POWER METER PW3337

LAN RS-232C GP-IB -01/-03 Model CE True RMS

| Model No. (Order Code) | (Note) |
|---|---|
| PW3337 | (3ch) |
| PW3337-01 | (3ch, with GP-IB) |
| PW3337-02 | (3ch, with D/A output) |
| PW3337-03 | (3ch, with GP-IB, D/A output) |

Accessories: Instruction manual ×1, Measurement guide ×1, Power cord ×1

# Options

## Current measurement options [Type 1] Can be directly connected to the current sensor input terminals on the PW3336/ PW3337 series

CLAMP ON SENSOR 9660
100 A AC, φ15 mm(0.59”), 40 Hz to 5 kHz
±0.3%rdg.±0.02%f.s. (Amplitude accuracy 45 Hz to 66 Hz)
±1° or less (Phase accuracy 45 Hz to 66 Hz)

CLAMP ON SENSOR 9661
500 A AC, φ46 mm(1.81”), 40 Hz to 5 kHz
±0.3%rdg.±0.01%f.s. (Amplitude accuracy 45 Hz to 66 Hz)
±0.5° or less (Phase accuracy 45 Hz to 66 Hz)

CLAMP ON SENSOR 9669
1000 A AC, φ55mm(02.17”), 80 × 20 mm (3.15” × 0.79”) busbar, 40 Hz to 5 kHz
±1.0%rdg.±0.01%f.s. (Amplitude accuracy 45 Hz to 66 Hz)
±1° or less (Phase accuracy 45 Hz to 66 Hz)

CLAMP ON SENSOR CT9667-01, CT9667-02, CT9667-03
500 A /5000 A AC Switchable, φ100mm to φ254 mm (3.94” to 10”), 10 Hz to 20 kHz
±2.0%rdg.±0.3%f.s. (Amplitude accuracy 45 Hz to 66 Hz)
±1° or less (Phase accuracy 45 Hz to 66 Hz)
Power supply : LR6 alkaline battery ×2, or AC Adapter (option)
Option : AC ADAPTER 9445-02 (universal 100 V to 240 VAC /for USA)
AC ADAPTER 9445-03 (universal 100 V to 240 VAC /for Europe)

## Current measurement options [Type 2] Requires SENSOR UNIT CT9555 or CT9557, and CONNECTION CORD L9217 to be connected to the current sensor input terminals on the PW3336/ PW3337 series

### 200 A or lower

AC/DC CURRENT SENSOR CT6862-05
50 A AC/DC, pass-through type, φ24 mm(0.94”), DC to 1 MHz
±0.05%rdg.±0.01%f.s. (Amplitude accuracy 16 Hz to 400 Hz)
±0.2° or less (Phase accuracy 16 Hz to 400 Hz)
Power supply : SENSOR UNIT CT9555 or CT9557 (option)

AC/DC CURRENT SENSOR CT6863-05
200 A AC/DC, pass-through type, φ24 mm(0.94”), DC to 500 kHz
±0.05%rdg.±0.01%f.s. (Amplitude accuracy 16 Hz to 400 Hz)
±0.2° or less (Phase accuracy 16 Hz to 400 Hz)
Power supply : SENSOR UNIT CT9555 or CT9557 (option)

AC/DC CURRENT PROBE CT6841-05
20 A AC/DC, clamp-on type, φ20 mm(0.79”), DC to 1 MHz
±0.3%rdg.±0.01%f.s. (Amplitude accuracy DC < f ≤ 100 Hz)
±0.1° or less (Phase accuracy DC < f ≤ 100 Hz)
Power supply : SENSOR UNIT CT9555 or CT9557 (option)

AC/DC CURRENT PROBE CT6843-05
200 A AC/DC, clamp-on type, φ20 mm(0.79”), DC to 500 kHz
±0.3%rdg.±0.01%f.s. (Amplitude accuracy DC < f ≤ 100 Hz)
±0.1° or less (Phase accuracy DC < f ≤ 100 Hz)
Power supply : SENSOR UNIT CT9555 or CT9557 (option)

CLAMP ON SENSOR 9272-05 (Scheduled for release in 2017)
20 A/ 200 A AC Switchable, clamp-on type, φ46 mm(1.81”),
1 Hz to 100 kHz
±0.3%rdg.±0.01%f.s. (Amplitude accuracy 45 Hz to 66 Hz)
±0.2° or less (Phase accuracy 45 Hz to 66 Hz)
Power supply : SENSOR UNIT CT9555 or CT9557 (option)

### 500 A or lower

AC/DC CURRENT SENSOR 9709-05
500 A AC/DC, pass-through type, φ36 mm(1.42”), DC to 100 kHz
±0.05%rdg.±0.01%f.s. (Amplitude accuracy 45 Hz to 66 Hz)
±0.2° or less (Phase accuracy 45 Hz to 66 Hz)
Power supply : SENSOR UNIT CT9555 or CT9557 (option)

AC/DC CURRENT PROBE CT6844-05
500 A AC/DC, clamp-on type, φ20 mm(0.79”), DC to 200 kHz
±0.3%rdg.±0.01%f.s. (Amplitude accuracy DC < f ≤ 100 Hz)
±0.1° or less (Phase accuracy DC < f ≤ 100 Hz)
Power supply : SENSOR UNIT CT9555 or CT9557 (option)

AC/DC CURRENT PROBE CT6845-05
500 A AC/DC, clamp-on type, φ50 mm(1.97”), DC to 100 kHz
±0.3%rdg.±0.01%f.s. (Amplitude accuracy DC < f ≤ 100 Hz)
±0.1° or less (Phase accuracy DC < f ≤ 100 Hz)
Power supply : SENSOR UNIT CT9555 or CT9557 (option)

### 1000 A or lower

AC/DC CURRENT SENSOR CT6865-05
1000 A AC/DC, pass-through type, φ36 mm(1.42”), DC to 20 kHz
±0.05%rdg.±0.01%f.s. (Amplitude accuracy 16 Hz to 66 Hz)
±0.2° or less (Phase accuracy 16 Hz to 66 Hz)
Power supply : SENSOR UNIT CT9555 or CT9557 (option)

AC/DC CURRENT PROBE CT6846-05
1000 A AC/DC, clamp-on type, φ50 mm(1.97”), DC to 20 kHz
±0.3%rdg.±0.01%f.s. (Amplitude accuracy DC < f ≤ 100 Hz)
±0.1° or less (Phase accuracy DC < f ≤ 100 Hz)
Power supply : SENSOR UNIT CT9555 or CT9557 (option)

## Type 2 Current sensor options

SENSOR UNIT CT9555
Power supply :
100 V to 240 V AC (50Hz/ 60Hz)

SENSOR UNIT CT9557
Four Sensors can be used.
With additive output function
Power supply: 100 V to 240 V AC (50Hz/ 60Hz)

CONNECTION CORD L9217
For sensor output,
Isolated BNC to isolated BNC
Cord length: 1.6 m (5.25 ft) length

## Communications and control options

RS-232C CABLE 9637
Cable length: 1.8 m (5.91 ft)
9pin to 9pin

RS-232C CABLE 9638
Cable length: 1.8 m (5.91 ft)
9pin to 25pin

GP-IB CONNECTOR CABLE 9151-02
Cable length: 2 m (6.56 ft)

LAN CABLE 9642
Cable length: 5 m (16.41 ft)
supplied with straight to
cross conversion cable

CONNECTION CORD 9165
For synchronized control
Cable length: 1.5 m (4.92 ft),
metal BNC to metal BNC



HIOKI

HIOKI E.E. CORPORATION

HEADQUARTERS
81 Koizumi, Ueda, Nagano, 386-1192, Japan
TEL +81-268-28-0562 FAX +81-268-28-0568
http://www.hioki.com / E-mail: os-com@hioki.co.jp

HIOKI USA CORPORATION
TEL +1-609-409-9109 FAX +1-609-409-9108
http://www.hiokiusa.com / E-mail: hioki@hiokiusa.com

HIOKI (Shanghai) SALES & TRADING CO., LTD.
TEL +86-21-63910090 FAX +86-21-63910360
http://www.hioki.cn / E-mail: info@hioki.com.cn

HIOKI SINGAPORE PTE. LTD.
TEL +65-6634-7677 FAX +65-6634-7477
E-mail: info-sg@hioki.com.sg

HIOKI KOREA CO., LTD.
TEL +82-2-2183-8847 FAX +82-2-2183-3360
E-mail: info-kr@hioki.co.jp

DISTRIBUTED BY

All information correct as of Nov. 25, 2016. All specifications are subject to change without notice.

PW3337E8-6YE Printed in Japan